

UNIT INFORMATION SHEETS FOR NS 5148 AT SHOP SCY ON 02/11/16 PAGE 1

TASKS AND INFO LISTED ARE VALID THROUGH END OF SHOPPING COMMENCING ON DATE SHOWN AT TOP OF PAGE (ML949A)

CRITICAL UNIT DATA			
	LAST DONE	SHOP	NEXT DUE
# LUBE	11/19/15	INM	01/01/16
- 3 MONTH - MAINT EXPEDITED	11/19/15	INM	03/29/16
- 6 MONTH	11/19/15	INM	06/10/16
- METER	05/08/15	INM	06/10/16
- 12 MONTH	05/08/15	INM	06/10/16
- 24/36/48/60	04/24/13	CHA	06/10/16
- EVENT RECORDER	11/19/15	INM	03/29/16
- EPA 1 YEAR	11/19/15	INM	11/20/16
- EPA 2 YEAR	05/08/15	INM	05/12/17
- EPA 3 YEAR	11/19/15	INM	11/26/18
- EPA 4 YEAR	11/19/15	INM	11/29/19
- EPA 6 YEAR	11/19/15	INM	12/04/21
- EPA 12 YEAR	11/19/15	INM	12/21/27
- MID-LIFE TUNE UP	05/08/14	JUN	05/23/20
# OVERHAUL	10/06/03	JUN	12/24/15
# TRUCK CHANGE	03/18/01	JUN	06/02/12
- RETRO REFLECTIVE	06/11/14	CHA	07/07/24
- BATTERY SET CHANGE	02/26/13	INM	03/25/23
# DUMP TOILET HOLDING	12/21/15	INM	01/01/16

AIR COMP: 09/25/03 AIR DRYER: ? OIL CHG: 11/05/14

RI: EPA: 0 RAILVIEW: N APU: K99

CAB SGNL: N TM TYPE: 723D77,40H BEARING TYPE: HYATT RMT CTL: N

COMPONENT CHANGE HISTORY		
DATE	DESCRIPTION	POS
11-19-2015	BATTERY, APU 38LB 8.99 L X 5.55 W	N/A
11-19-2015	FILTER, LUBE OIL	N/A
11-19-2015	GASKET COVER LUBE OIL FILTER MICHIANA	N/A
11-19-2015	BOTTLE, PLASTIC 4 OZ, 525 IN A CASE	N/A
11-18-2015	FILTER, APU & AIR COMP LUBE OIL	N/A
11-18-2015	ELEMENT, AIR COMPRESSOR FILTER, ROUND	N/A
11-18-2015	ELEMENT, SPIN ON FUEL FILTER	N/A
11-18-2015	GASKET COVER FUEL OIL FILTER	N/A
11-18-2015	FILTER, LUBE OIL	N/A
11-18-2015	ELEMENT, FIBERGLASS BAGGY TYPE FILTER	N/A
11-18-2015	INJECTOR, FUEL 12-64SE NON-TURBO TIER 0	ALL
11-18-2015	LUBRICANT, SODIUM BASE 1LB	ALL
11-18-2015	LUBRICANT, SODIUM BASE 1LB	ALL
11-18-2015	SHOE, COMPOSITE BRAKE 2IN	ALL
11-18-2015	SHOE, COMPOSITE BRAKE 2IN	ALL
11-17-2015	NOZZLE, SANDING(HOSE/BOOT/SANDER)	ALL
11-17-2015	BOTTLE, PLASTIC 4 OZ, 525 IN A CASE	N/A
08-11-2015	BRUSH, TRACTION MOTOR SD60 EMD 9582217	ALL

UNIT INFORMATION SHEETS FOR NS 5148 AT SHOP SCY ON 02/11/16 PAGE 2

TASKS AND INFO LISTED ARE VALID THROUGH END OF SHOPPING COMMENCING ON DATE SHOWN AT TOP OF PAGE (ML949A)

08-11-2015	BRUSH, GRADE AG137	ALL
08-11-2015	BRUSH, TRACTION MOTOR SD60 EMD 9582217	ALL
08-11-2015	BRUSH, GRADE AG137	ALL
08-11-2015	ELEMENT, SPIN ON FUEL FILTER	N/A
08-11-2015	GASKET COVER FUEL OIL FILTER	N/A
08-11-2015	FILTER, LUBE OIL	N/A
08-11-2015	LUBRICANT, SODIUM BASE 1LB	ALL
08-11-2015	LUBRICANT, SODIUM BASE 1LB	ALL
08-11-2015	BOTTLE, PLASTIC 4 OZ, 525 IN A CASE	N/A
08-11-2015	BOTTLE, PLASTIC 4 OZ, 525 IN A CASE	N/A
08-11-2015	SHOE, COMPOSITE BRAKE 2IN	ALL
08-11-2015	SHOE, COMPOSITE BRAKE 2IN	ALL
08-11-2015	NOZZLE, SANDING(HOSE/BOOT/SANDER)	ALL

UNSCCHEDULED SHOPPING HISTORY

10-19-2015 MAC 08/18 - REPORTED AIR CONDITIONER  
 09-17-2015 MAC LCDI CAT: CREW CAB PROBLEM , DEF: AIR CONDITIONING

LATEST WHEEL DATA

AXLE	LRT	LFH	LFT	RRT	RFH	RFT
1	1 4/16	1 3/16	1 7/16	1 3/16	1 3/16	1 6/16
2	2 10/16	1 5/16	1 8/16	2 8/16	1 7/16	1 1/16
3	2 11/16	1 3/16	1 5/16	2 11/16	1 3/16	1 5/16
4	2 11/16	1 7/16	1 7/16	2 12/16	1 7/16	1 6/16

KIPS READING > 75

POS PEAK DATE  
 HAS NO WHEEL DATA AVAILABLE

OPEN ACCIDENTS

HAS NO OPEN ACCIDENTS

TROUBLE HISTORY

MF 12-21-2015 GOVERNOR TROUBLE  
 UNIT TROUBLE COMMENTS:  
 LCDI CAT: PROTECTIVE DEVICE, DEF: TRIPPED GOV BUTTON,OTHER,GOVERNOR BUTTON  
 & LOW WATER BUTTON TRIPPED, ENGINE IS LOW ON WATER TA M3M M3M  
 MECH DEPT ASSESSMENT COMMENTS:  
 UTCS...CAUSE LOW WATER & GOVERNOR BUTTONS...TA  
 RESOLVED: BY:

TT 12-16-2015 STORE UNIT  
 UNIT TROUBLE COMMENTS:  
 CONTACT SOC UPON ARRIVAL AT SHOP TO BE PLACED IN STORED STATUS. UNIT  
 SHOULD BE STORED AT THE FOLLOWING LOCATION:SCX

UNIT INFORMATION SHEETS FOR NS 5148 AT SHOP SCY ON 02/11/16 PAGE 3

TASKS AND INFO LISTED ARE VALID THROUGH END OF (ML949A)  
SHOPPING COMMENCING ON DATE SHOWN AT TOP OF PAGE

RESOLVED: BY:

TT 10-17-2015 NOT LOADING PROPERLY/WSA/TRANS

UNIT TROUBLE COMMENTS:

REPORTED UNIT NOT LOADING PROPERLY , GETTING WHEELSLIP LIGHT.

MECH DEPT RESOLUTION COMMENTS:

FOUND AND REPAIRED BURNT TM #1 FF LEAD. ALL LOADING OPS CHECK GOOD

RESOLVED: 10-19-2015 17:21 BY: MAWSA

TT 09-26-2015 KICKING GROUND RELAY

UNIT TROUBLE COMMENTS:

09/26-REPORTED GROUND RELAY KEEPS TRIPPING AND KILLING THE POWER SUPPLY

MECH DEPT ASSESSMENT COMMENTS:

UNABLE TO DUPLICATE IN SHOP NEED TO BE ROLLED TO BE CHECKED FOR A ROLLING

GROUND,FOUND BARE SPOT WHERE A SPLICE WAS MADE AT #1 MOTOR PUT A RUBBER

BOOT OVER SPLICE STILL NEEDS TO BE

MECH DEPT RESOLUTION COMMENTS:

RAN ON C/O WITH NO TROUBLE

RESOLVED: 10-08-2015 05:32 BY: NQCZX

TT 09-16-2015 GOVERNOR TROUBLE

UNIT TROUBLE COMMENTS:

LCDI CAT: PROTECTIVE DEVICE, DEF: TRIPPED GOV BUTTON,OTHER,TRIPS AT OVER

800 AMPS IN POWER. ALSO LEAKING GOV OIL AT THE SIGHT GLASS.

MECH DEPT ASSESSMENT COMMENTS:

GOVERNOR WAS OVER FILLED WITH FLUID

MECH DEPT RESOLUTION COMMENTS:

ALLOWED FLUID TO DRAIN, CLEANED SIGHT GLASS

RESOLVED: 09-17-2015 15:51 BY: MBDSP

TT 09-16-2015 OIL OUT STACK

UNIT TROUBLE COMMENTS:

LCDI CAT: EXHAUST SYSTEM, DEF: OIL OUT THE STACK,OTHER,

MECH DEPT ASSESSMENT COMMENTS:

NO OIL FOUND

MECH DEPT RESOLUTION COMMENTS:

EXCESS RAIN HAD BUILT IN STACKS AND BLEW OUT UPON STARTING NO OIL ON

WALKWAY

RESOLVED: 09-17-2015 15:49 BY: MBDSP

TT 09-15-2015 FEDERAL INSPECTOR REPORT ITEMS

UNIT TROUBLE COMMENTS:

STARTER MOTOR COVER LOOSE - APU EXHAUST DISCONNECTED - APU ELECTRIC

CABINET NOT SECURE - MAIN GEN ROOM FLOOR NOT SECURE - ELECTRIC LOCKER DOOR

NOT SECURE MAIN GEN ROOM - REAR SAFETY

MECH DEPT RESOLUTION COMMENTS:

SECURED STARTER MOTOR COVER - RE CONNECTED APU EXHAUST - SECURED APU

CABINET - SECURED MAIN GEN ROOM FLOOR - SECURED ELECTRIC LOCKER DOOR IN

MAIN GEN ROOM - ADJUSTED SAFETY CAHIN

RESOLVED: 09-15-2015 15:48 BY: MXD9V

UNIT INFORMATION SHEETS FOR NS 5148 AT SHOP SCY ON 02/11/16 PAGE 4

TASKS AND INFO LISTED ARE VALID THROUGH END OF (ML949A)  
SHOPPING COMMENCING ON DATE SHOWN AT TOP OF PAGE

TT 08-28-2015 CREW CAB TROUBLE  
UNIT TROUBLE COMMENTS:  
LCDI CAT: CREW CAB PROBLEM , DEF: DOOR, DOOR WILL NOT STAY CLOSED DOOR  
SWINGS OPEN WILL NOT LATCH SHUT  
MECH DEPT ASSESSMENT COMMENTS:  
DOOR NEEDS REPLACEMENT AT NEXT ROUTINE MAINT. NPIS MAC 9/29  
MECH DEPT RESOLUTION COMMENTS:  
NOT DONE AT THIS LOCATION  
RESOLVED: 10-08-2015 05:33 BY: NQCZX

TT 08-18-2015 AIR CONDITIONER  
UNIT TROUBLE COMMENTS:  
LCDI CAT: CREW CAB PROBLEM , DEF: AIR CONDITIONING, DRAIN PAN IS NOT  
DRAINING AND CAUSING THE FLOOR TO GET WET THEREFORE A POSSIBLE SLIPPING  
HAZARD. THE FLOOR IS WET  
MECH DEPT ASSESSMENT COMMENTS:  
NPIS MAC 9/29 ACK MAC 10/8ACK MAC 10/13 INM 12-19-15  
RESOLVED: BY:

LAB ANALYSIS HISTORY

	PB	CU	FE	AL	SI	CR	B	ZN	V100	%F	HD	PPI	OS
01-02-2016		4	5	1	5	1	12		15.4	223	22	31	23
12-21-2015	2	7	12	2	7	3	32	1	10.1	228	15	45	26
11-17-2015	4	5	11	2	4	2	22	1	15.2	223	18	41	24
10-13-2015	1	3	7	2	3	1	5		15.5	224	14	37	23
09-29-2015	7	7	21	2	7	2	4	2	15.4	217	18	55	26
08-11-2015	2	4	7	2	3	1	2	1	15.1	216	15	39	22

NOTICES DUE

- MDH MO 5797 APPLY NEW COVERED KNUCKLE BOXES REQ'D BY FRA :
- MDH MO 6653 Dash-2 Locomotive Cab Replacement
- MDH MO 6821 Remove Exterior Toilet Dump Slide Valve
- MDH MO 6825 Replace toilet top
- MDH WR 221 Replace Toilet Floor Flange Seal
- MDH WR 222 Apply Toilet Chemical Sticker to Toilet

UNRESOLVED LAB DATA

HAS NO UNRESOLVED LABS